

425 South Telshor Blvd
Suite C-103
Las Cruces, NM 88011
www.bhinc.com
voice: 575.532.8670
facsimile: 575.532.8680

TO:

DATE:	6/15/2026 - 6/18/2026
REPORT NUMBER:	6
PROJECT NUMBER:	20260236
PROJECT:	Tyrone Water System Improvements Construction
LOCATION:	403 Chalcocite St, Tyrone, New Mexico, 88065
OWNER:	Tyrone WWA
PRIME CONTRACTOR: SUB- CONTRACTORS:	SmithCo Construction None
PROJECT MANAGER: OBSERVER:	Tyler Hopkins Ruben Polanco

DATE: Monday 6/15/2026

WEATHER:

OVERNIGHT:

High: 89 °F, Low: 61°F, Rain. Wind Speed: 14 mph,
Gusts 38 mph. Precipitation: 0.15

CONTRACTOR HOURS:

FIELD OBSERVATIONS:

7:30AM-5:30PM

9:30AM-3:30PM

VISITORS ON SITE:

SUB-CONTRACTORS ON SITE:

None reported

EQUIPMENT ON SITE

SmithCo Construction

- 2 Bomag 8500 Trench Roller
- 2 Cat 420 Backhoe
- 2 Cat 420F Backhoe
- 1 Cat 289D Skid Steer
- On site, unused: Cat 966M Loader
- 1 Freightliner Water Truck
- 1 International Dump Truck - End Dump
- On site, unused: John Deere 410L Backhoe
- 1 Peterbilt Water Truck
- 2 Vermeer VX50-500

PERSONNEL ON SITE

SmithCo Construction

- 1 Superintendent
- 13 Laborer
- 2 Foreman
- 4 Operator

WORK DESCRIPTION

Crew #1-- The contractor continued to place 12" C-900 on Copper Dr. as per design. 45 DI bends were used to go under the existing storm drain at sta. 36+03 to sta. 36+21.

Crew #2-- The contractor continued to place 6" C-900 on Cuprite St. as per design.

The contractor also welded 80LF of 24" Steel casing. Summit Technical lab was on site to take compaction tests for both crews. All tests taken passed.

WORK CONVERSATIONS

Eddie Mendoza and Alan Berg (Tyrone) requested a fire hydrant move on Copper Dr. The existing hydrant at Sta. 38+50 has a 2' rock wall built around it, making it difficult for the contractor to remove and replace in the same location. Mendoza and Alan are requesting a move to the NW corner at approx. sta 37+80. Tyler (BHI PM) was notified and the hydrant move was approved.

IMAGES



12" C-900 being placed on Copper Dr.



DI fittings being installed on Copper Dr. for the 12" C-900



As-Built survey shots being taken on 12" DI fittings on Copper Dr.



Exposing existing water line on Cuprite St. Crew #2 will use DI 45s to go under.



Welding of 24" steel casing for 12" C-900 on Copper Dr.

DATE: Tuesday 6/16/2026

WEATHER:

High: 97 °F, Low: 69°F, Clear. Wind Speed: 22 mph, Gusts 33 mph

OVERNIGHT:

CONTRACTOR HOURS:

7:30AM-5:30PM

FIELD OBSERVATIONS:

9:30AM-3:30PM

VISITORS ON SITE:

None reported

SUB-CONTRACTORS ON SITE:

EQUIPMENT ON SITE

SmithCo Construction

- 2 Bomag 8500 Trench Roller
- 2 Cat 420 Backhoe
- 2 Cat 420F Backhoe
- 1 Cat 289D Skid Steer
- On site, unused: Cat 966M Loader
- 1 Freightliner Water Truck
- 1 International Dump Truck - End Dump
- On site, unused: John Deere 410L Backhoe
- 1 Peterbilt Water Truck
- 2 Vermeer VX50-500

PERSONNEL ON SITE

SmithCo Construction

- 1 Superintendent
- 13 Laborer
- 2 Foreman
- 4 Operator

WORK DESCRIPTION

Crew #1-- The contractor continued to place 12" C-900 on Copper Dr. The contractor will eliminate the DI 45 bends for sta. 38+14 to sta. 38+35. The existing water line stayed well south of the trench, and the contractor did not need to go under the existing line.


Crew #2-- The contractor finished placing the 6" C-900 on Cuprite St. as per plan. A DI cap was placed at sta. 37+65. Crew #2 will be moving to Chalcocite St. and tie into the 12x6 tee on Copper Dr. at sta. 10+18.

As-built survey shots were taken on all fittings. Summit lab was onsite to take backfill densities. All tests taken passed.

WORK CONVERSATIONS



Wrapping anticorrosion plastic around 12" fittings on Copper Dr.

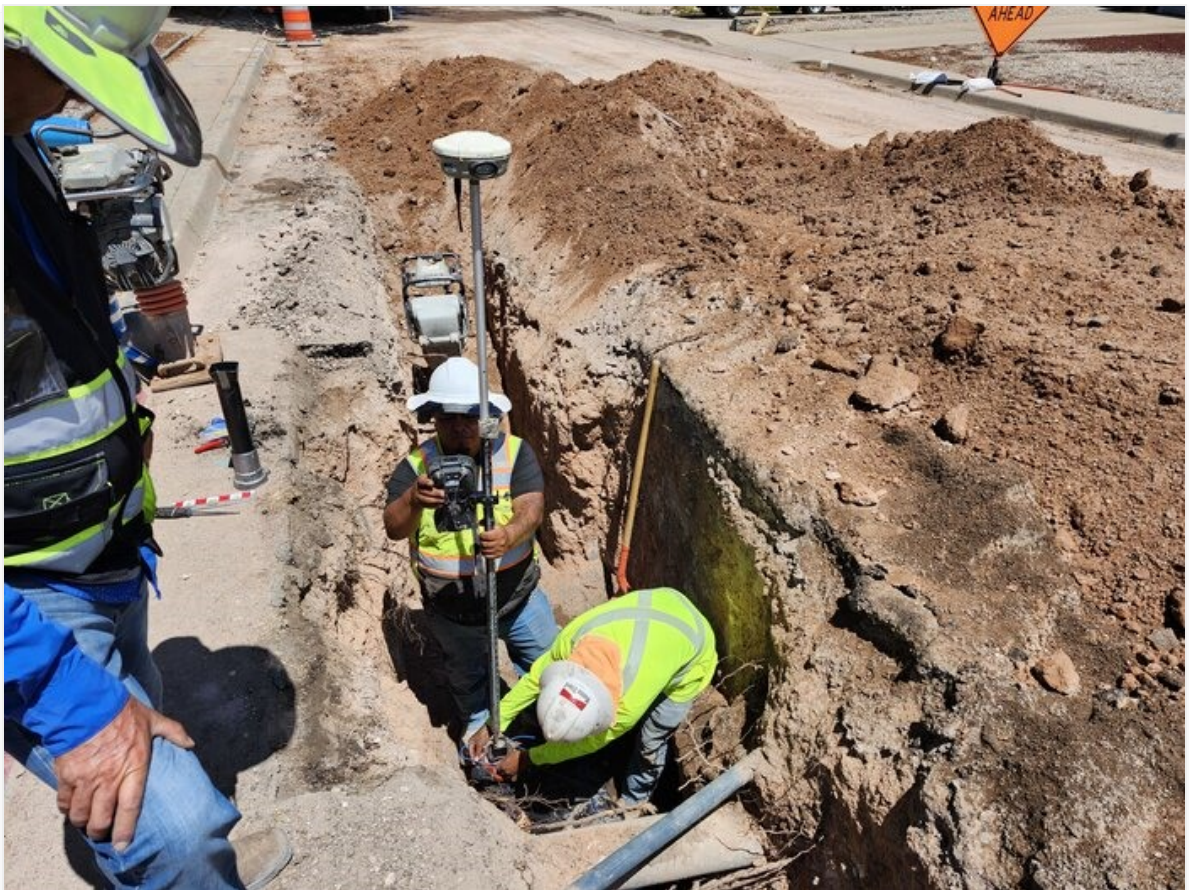

As-built survey shot being taken on 6" DI fitting.



Crew #2 attaching fittings outside trench for connection to 12x6 tee on Copper Dr.

DATE: Wednesday 6/17/2026

WEATHER:

High: 96 °F, Low: 72°F, Rain. Wind Speed: 32 mph,
Gusts 42 mph. Precipitation: 0.011

OVERNIGHT:

CONTRACTOR HOURS:

7:30AM-5:30PM

FIELD OBSERVATIONS:

9:30AM-3:30PM

VISITORS ON SITE:

None reported

SUB-CONTRACTORS ON SITE:

EQUIPMENT ON SITE

SmithCo Construction

- 2 Bomag 8500 Trench Roller
- 2 Cat 420 Backhoe
- 2 Cat 420F Backhoe
- 1 Cat 289D Skid Steer
- On site, unused: Cat 966M Loader
- 1 Freightliner Water Truck
- 1 International Dump Truck - End Dump
- On site, unused: John Deere 410L Backhoe
- 1 Peterbilt Water Truck
- 2 Vermeer VX50-500

PERSONNEL ON SITE

SmithCo Construction

- 1 Superintendent
- 13 Laborer
- 2 Foreman
- 4 Operator

WORK DESCRIPTION

Crew #2-- The contractor tied into the 12x6 tee on Copper for Chalcocite St. An 11.25 DI bend was placed at sta. 10+63 as per plan. Hydrant #43 and #44 will be moved as per the new hydrant locations. Contractor placing 6" C-900 on Chalcocite St.

Crew #1-- Continued to place 12" C-900 on Copper Dr.as per plan. The contractor crossed from north side of Copper to south side at sta. 39+14 to sta.39+36 using DI 45 bends as per plan.

Summit onsite to take backfill densities. All tests taken passed.

WORK CONVERSATIONS

IMAGES



Crew #1 south side of Copper Dr excavation.



As-Built survey being taken on 6" fitting on Chalcocite St.



6" C-900 placement on Chalcocite St.



Summit testing backfill over 6" C-900 on Chalcocite St.

DATE: Thursday 6/18/2026

WEATHER:

High: 93 °F, Low: 70°F, Partially cloudy. Wind
Speed: 26 mph, Gusts 41 mph

OVERNIGHT:

CONTRACTOR HOURS:

7:30AM-5:30PM

FIELD OBSERVATIONS:

9:30AM-3:30PM

VISITORS ON SITE:

None reported

SUB-CONTRACTORS ON SITE:

EQUIPMENT ON SITE

SmithCo Construction

- 2 Bomag 8500 Trench Roller
- 2 Cat 420 Backhoe
- 2 Cat 420F Backhoe
- 1 Cat 289D Skid Steer
- On site, unused: Cat 966M Loader
- 1 Freightliner Water Truck
- 1 International Dump Truck - End Dump
- On site, unused: John Deere 410L Backhoe
- 1 Peterbilt Water Truck
- 2 Vermeer VX50-500

PERSONNEL ON SITE

SmithCo Construction

- 1 Superintendent
- 11 Laborer
- 2 Foreman
- 4 Operator

WORK DESCRIPTION

Crew #2-- The contractor continued to place 6" C-900 on Chalcocite St. as per plan.

Crew #1-- The contractor to place 12" C-900 on Copper Dr as per plan.

Summit testing was onsite to take backfill densities for both crews. All tests taken passed.

10LF of curb and gutter and 35SF of sidewalk was removed at sta. 42+85. The contractor will be excavating for the 24" steel casing on Monday.

WORK CONVERSATIONS

IMAGES




As-built survey on DI 45 bends on Copper Dr.



Milling Chalcocite 6" C-900 pipe alignment.



6" C-900 pipe operations.

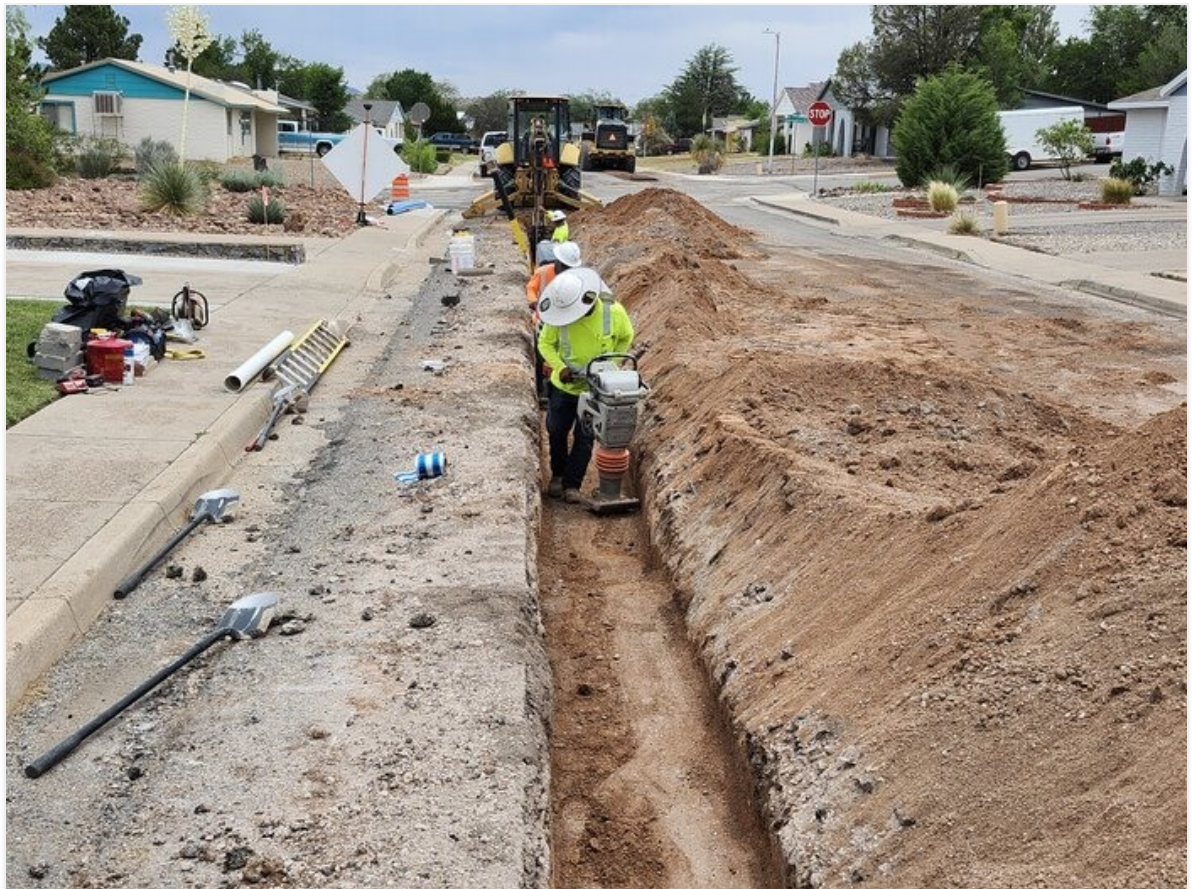

6" C-900 compaction efforts on Chalcocite St.



Saw cutting sidewalk on Copper Dr at sta. 42+85.

COPIES TO:

ccasey@bhinc.com
rpolanco@bhinc.com
thopkins@bhinc.com

REVIEWED

6/19/2026



Tyler R. Hopkins

FIELD REPORT SIGNED

6/19/2026



Ruben Polanco